N989SR Piper PA-32R-301T Sn. 3257268





THE NEW PIPER AIRCRAFT, INC.

General Offices at Vero Beach, Florida U.S.A.

N989SR

Aircraft

Registration number

Part No. 230715

NOTICE

Making false entries in this book is a violation of government regulations and is punishable by civil penalty.

PAINT TYPE: DUPONT IMPON 2000

AIRCRAFT DESCRIPTION

Registration No.	189SR			
Model: PA-32R-301T	Popular Name:	SARA	TOGA IL TC	
Serial No.: 3257268 DOCOSHD MICOSHD Colors: WHITE MED. MAROON DARK MET. 4	Type Certificate A HEIGE M	NO : A 3	SD 1005HD MAROON DARKMET	DASIAHD SILVER
Engine Manufacturer: LYCOMING	. Serial Numbers:	Single L-//	082-61A	MET
Original Engine Model: TIO-540-AHIA		Left		
Propeller Manufacturer: HARTZELL Original Propeller Model: HC-I3YR-IRF	. Hub or Serial Nu	Right	1K784B	
		Right		
В	lade Numbers			
Left		Right		
T63777				
J63776			•	
J63780			2002 MC	DDEL

COMPLIANCE WITH FAA AIRWORTHINESS DIRECTIVES

A. D. No. and Date	Method of Compliance (See Log for Details)	Time on Aircraft	Date of Compliance	Signature and Certificate No. DOR SO-
AH applicable Pederal Avia	Hon Administration Airworthiness	10.4	NB 19 200	John & Hambleton
nave been complied with at t	he time of manufacture.		NOW TO	N S. HAMBLETO

COMPLIANCE WITH FAA AIRWORTHINESS DIRECTIVES

A. D. No. and Date	Method of Compliance (See Log for Details)	Time on Aircraft	Date of Compliance	Signature and Certificate No

	Aircraft Time		Recorder	Maintenance		
Date	This Date	Total	Reading	Maintenatice		
PR 1 9 2002	Brought Forward	10.4	for the certi	e aircraft meets the requirements ication requested and have issued		
			a Standard	Airworthiness Certificate,		
			Dated	APR 1 9 2002		
				lambleton FAA DOA SO-1		
			JOHN S. H	AMBLETON TETER AND STATIC SYSTEM		
				UIRED BY FAR PART 91.411		
			MAYE BEEN	PERFORMED. THE ALTIMETERISI		
			HAVE BEEN	TESTED TO 20,000 FT.		
			ONIE	17/0/ RI NA		
			SIGNED	m & Hamblita DATE APR 1 9 2002		
			JOHN'S	HAMBLETON		
			The El	T is installed per 207. Battery re-		
				Mandleton		
Total To Carry Forward		10.4	Ø.O.A. The Ne	No. SO-1 w Piper Aircraft, Inc.		
		10.4	placen Ø.O.A. The Net	Manketon		

Registration No. N989SR

and Rem	
Tom:	
The	
FAI	NORTHERN AIR
COI	
ATC	LOG BOOK ENTRY Dated: 06/13/02 N# 989SR
1.	Make: PIPER Model: PA-32R-301 SN: 3257268
1,4	Total time: 23.1 Hobbs Time: 23.1
2.	
	Complied with SL 1049 by installing a new voltage regulator and installing a 1/4 amp fuse. Repaired the
Det	fuse holder wire as needed, P/N 68804-007, S/N C042344.
S/N	Repositioned the insulation behind the trim around the pilots and copilots windshield.
Q.A	Installed the fire extinguisher under the copilots seat. Removed the left wing fuel gauge, adjusted the float arm, and reassembled the gauge. Refueled the tank and checked the operation of the gauge, no defects were noted.
	Performed an operational check, and no discrepancies were noted. This work was done per the Piper PA-32R-301 maintenance manual.
	The work identified above was performed in accordance with the current Federal Aviation Regulations and was found to be airworthy for return to service. Pertinent details are on file at this agency under; W/O# 36755, 36774, & 36775 Signed: DATED: 06/13/02 for NORTHERN AIR INC., CRS# N81R812N, GERALD R, FORD INT'L AIRPORT, GRR, MI. 49512

	Aircraft Time		Recorder	AAudutuusus
Date	This Date	Total	Reading	Maintenance
PR 1 9 2002	Brought Forward →	10.4	for the certi	e aircraft meets the requirements ication requested and have issued
			Dated	APR 1 9 2002
			John J. Y	bubleton FAA DOA SO-1
			JOHN S. H	AMBLETON ETER AND STATIC SYSTEM
			TEST REQ	VIRED BY FAR PART 91.411
			HAYE BEEN	PERFORMED. THE ALTIMETERISI TESTED TO 20,000 FT.
			SIGNED	and Hambleto DATE APR 1 9 200
			IOHN'S	HAMBLETON
			FAR 9	T is installed per 207. Battery re-
				ment date 3/2004
Total To Carry Forward		10.4	Ø.O.A.	No. SO-1 v Piper Aircraft, Inc.

Registration No. N989SR

nd Remarks	Signature	Certifi
The ATC Transponder Tests and Inspections required by FAR 91 413 were performed this date and found to comply with FAR 43. Appendix F. ATC Transponder: 1. Make GARMIN Model GTX-327 S/N 83708426 2. Make NA Model NA S/N NA Details of this inspection are on file at this facility under S/N 3257268 Date 3/14/02 Q.A. Inspector John N. Hamblet. THE NEW PIPER AIRCRAFT, INC. VERO BEACH, FLORIDA		
JOHN S. HAMBLETON		
THE AUTOMATIC PRESSURE ALTITUDE REPORTING EQUIPMENT TEST REQUIRED BY FAR PART 91217 HAVE BEEN PERFORMED THIS DATE: 3/4/02 SIGNED John S. HAMBLETON		

	Aircra	ft Time	Recorder	Maintenance					
Date	This Date	Total	Reading	Maintenance					
	P								
	- I	MAYDA	Y AVIONICS, IN	C N989.5D					
	DATE	1. 4-2-03	DEDAID STA	ITSD047M					
		DATE: <u>4-2-03</u> REPAIR STA: IT5R947M Certified Altimeter, Transponder, Static System & En-							
		coder I.A.W. 91.411 & 91.413. System complies with paragraph (c), appendix E, of Part 43. Certified to							
	20,000	20,000 feet.							
		08	my Molega	ook.					
		5	6# 391184						
			0 01101						
			LOGBOOK ENTRY						
	MEC /			HOBBS 0024.0					
	A/C RE	EC N 9 8938 S	1N 2257268	SO# 37660.					
				30 + 530 TO ALLOW					
				TH 28VDC PIMMERBUS					
				THIS SYSTEM AND					
				GROUND TESTED AS					
				E AIRCRAFT HAS					
		RETURNED TO							
al To				AY AVIONICS INC					
rry Forward	1 /st	T5R947M	DAT	TE 6/14/02					

Registration	No			
--------------	----	--	--	--

nd Remarks		Signature	Certificate No.
NO	RTHERN AIR		
Performed annual ELT inspection The ELT battery expires Ma Complied with SL 1049 by replacements of the complied with SB552 by removal it's arrival back. Removed and replaced vacuur lestalled the oil cooler kit in accordance.	acing the voltage regulator. Part no. 68804 ring the engine and shipping to Lycoming for and gyro filters. cordance with SL 1043 and the instruction v	(d)007, serial no. C081934. or repairs and reinstalling u	pon
Installed a new Gill aircraft batt Removed the Tannis kit for eng Complied with AD 2002-26-01, diagram #18, replaced clare Found that VSP137 and Parke	pine repairs and cleaned and reinstalled. Inspected fuel injection lines in accordance on #5 cylinder fuel line. In Hannifin SB7073 does not apply to these the installed cylinders is not the one specification of the second with nitrogen.	e with Lycoming SB 342D landing gear cylinders beca ied in VSP137 and SB7073	

Adjusted engine manifold pressure. Adjusted engine speed. Adjusted the engine mixture. Performed an operational and leak check, as needed, on the above listed items, and no discrepancies were noted. This work was done per the Piper PA-32R maintenance manual. I certify that this aircraft has been inspected in accordance with an Annual Inspection & was determined to be in an airworthy condition. Pertinent details on file at this agency under; W/O# 37602 Signed: DATED: 04/09/03 for Day Book NORTHERN AIR INC., CRS# N81R812N, GERALD R, FORD INT'L AIRPORT, GRR, MI. 49512 38-03 Hollos 74h Replaced R + Main time wifer. Cleaned & repacked to heal bearings & Harly. Not f Bulanski A+P37060 24(7)		Aircraft	Time	Recorder	AAuinta	
Adjusted engine manifold pressure. Adjusted engine speed. Adjusted the engine mixture. Performed an operational and leak check, as needed, on the above listed items, and no discrepancies were noted. This work was done per the Piper PA-32R maintenance manual. I certify that this aircraft has been inspected in accordance with an Annual Inspection & was determined to be in an airworthy condition. Pertinent details on file at this agency under; W/O# 37602 Signed: DATED: 04/09/03 for Day Book NORTHERN AIR INC., CRS# N81R812N, GERALD R, FORD INT'L AIRPORT, GRR, MI. 49512	Date	This Date	Total	Reading	Maine	nance
Inspection & was determined to be in an airworthy condition. Pertinent details on file at this agency under; W/O# 37602 Signed: DATED: 04/09/03 for Day Biolog NORTHERN AIR INC., CRS# N81R812N, GERALD R, FORD INT'L AIRPORT, GRR, MI. 49512 30-03 Holos 74h Replaced R + wan the w/war. Cleaned & repacked	Adjusted eng Adjusted the Performed a	gine speed. engine mixture. n operational and leal	check, as need		d items, and no discrepancies	
	W/O# DATED: NORTHERN	ves determined to be in 37602 04/09/03 I AIR INC., CRS# N8	an airworthy cond. Signed: for 1R812N, GERA	Ucupe B LDR, FORD INTL AI	Tile at this agency under; Who per the second of the party of the part	icl

and Remark	LOGBOOK ENTRY MAYDAY AVIONICS INC. 18 MFG Piper MDL PR-32R-301THOBBS 109.7	Certificate N
	A/C REG N. 989\$R S/N 3257268 SO# 41882 Performed Garmin Software S.B. 0204 to 6NS-530	
	Nav Com S.D. 78404139. Complies W/ Piper VSP142. AFTER SERVICE WAS PERFORMED THIS SYSTEM AND	
	ALL ASSOCIATED SYSTEMS WERE GROUND TESTED AS REQUIRED BY FAR 43.13 AND THE AIRCRAFT	
	HAS BEEN APPROVED FOR RETURN TO SERVICE. OP ORDER 10-28-04 CRS # UT5R947M	
	LOGBOOK ENTRY MAYDAY AVIONICS INC. MFG P. Per MOL PA 32 R-3011 HOBBS 109.7	
	A/C REGN989 SR 5/N 3257268 50# 41883 Removed AP compter + sevet to Stec to compay W.	
	Ster SR 04-001/PiPer VSP-163 345 GND Ted Good AFTER SERVICE WAS PERFORMED THIS SYSTEM AND ALL ASSOCIATED SYSTEMS WERE GROUND TESTED	
	AS REQUIRED BY FAR 43.13 AND THE AIRCRAFT HAS BEEN APPROVED FOR RETURN TO SERVICE.	
	CRS # IT5R947M DATE 10/27/4 -	

Registration No.__

	7	ORTHERN	AIR	N 989SR Hobbs: 109.7	nce
Airframe la Make: <u>I</u>	og book entry <u>Piper</u>	Date: <u>10/27/2004</u> Model: <u>PA-32R-3011</u>	Serial No: <u>3257268</u>	Total Time: Landings:	
Performed an manual.	Annual inspection	n on this airframe per FAR 43	appendix D and the Piper	PA-32R-301T maintenance	
Performed and	nual ELT inspection	n and operational checks pe	er FAR 91.207(d). The ELT b	attery expires March of 2005.	
Reinstalled the Performed AD noted. Performed 50 Removed and Performed a 3 battery. Performed the Serviced all flu	e suction screen w 2 2002-26-01 by insi- and 100 hr lube Ite d replaced both vo 30 day battery box e 90 day fuel strain pids and pressures.	ems per chapter 12-20-00 of acuum regulator and gyro c c, cable, and battery inspect er/bowl cleaning and inspec	ued, and safetied the cap lines in accordance with S the PA-32R-301/301T main central air filters. tion. Found battery low on ction.	B342D and no defects were tenance manual. charge and charged	
DBA safetech	P/N 895-24050 S/N	T279-9660 removed for hydro N ALT279-9660. Installed O2 b d maintenance manual 35-1	oottle in aircraft. Serviced (ected bottle from Shoreline O2 to 1800PSI. No leaks noted.	
Adjusted pass good.	senger door closin	g/opening mechanism and	lubricated door and lock.	Operational check of door	
Total To					

Registration	No,		
--------------	-----	--	--

	Complied with AD 2004-14-12C, per instructions in Piper Service Bulletin number 1139A Control Wheel Attachment Inspection & Retainer Clip Installation.	, N
	Installed new right wing inboard fuel quantity sender. Performed the fuel quantity calibration and drained the fuel to check the low fuel exceedence/alarm. All operational checks were ok. All work performed in accordance with	
	the Piper PA32R-301T maintenance manual. No leaks were noted. The p/n's-486-467 and the old \$/N-1516 and the	
	new \$/N-1691.	
	Adjusted Aileron control cable tensions, wing Aileron adjustment rods, both wing aileron stops and cushion for	
	control yokes per Piper PA-32R-301/301T Airplane Maintenance Manual, Chapter 27-10-00. Operational and travel	_
	checks good.	
	Tensioned Stabilator cables and adjusted cables for proper cushion on control yokes. Operational check and	
	travel check of Stabilator system good per Piper PA-32R-301/301T Airplane Maintenance Manual, Chapter 27-20-	
	00.	
	Tensioned rudder cables per Piper Airplane Maintenance Manual PA-32R-301/301T, Chapter 27-20-00, and also	
	adjusted right rudder stop bott to allow full travel.	
	Piper SB 1135 on GMA audio panel wiring does not apply by mod level of installed audio panel.	_
	Complied with V\$P 155 by removing the left and the right landing gear actuators and installing kit P/N 767-370 in	
	accordance with 199-538A seal repair kit instructions and reinstalling the actuators. No leaks noted. Operational	_
	check satisfactory.	
	Installed new bearings and races in the nose wheel.	
	Ran up the aircraft and adjusted the vacuum regulator.	
	Removed the nose gear actuator and installed new packing. No leaks noted and all operational checks were ok.	
	Installed a compass card and performed a compass swing and filled out the compass deviation on the compass	
	card.	
•	rformed an operational and leak check, as needed, on the above listed Items, and no discrepancies were	
	ted. This work was done per the Piper PA-32R-301T series maIntenance manual.	
1	certify that this aircraft has been inspected in accordance with an Annual Inspection and was determined to be	
	in an airworthy condition., Pertinent details op file at this agency under;	
No	ork Order # 41688 Signed: (Abuse Global for CRS N81R812N	-
	Northern Air Inc., P.O. Box 888380, Gerald Ry Ford Int'l Airport, Grand Rapids, MI. 49588-8380	

	N	ORTHERN	AIR	N 989SR Hobbs: 143.5	ce
	e log book entry e: Piper	Date: 10/19/2005 Model: PA-32R-3011	Serial No: 3257268	Airframe Total Time: 143.5 Landings:	
		on this airframe per FAR 43	appendix D and the Piper I	PA-32R-301T maintenance	
installed ne Operations	il checks were ok and	ept. 2007. Performed an and I no defects were noted.			
the suction	screen with a new cr	rush gasket, torqued, and sat	fetied the cap.	nd none was noted, Reinstalled	
noted. The lines.	next inspection is du	e at (+100) hours, (+1 year), (d clamps per Lycoming SB or after any maintenance i	342D, and no discrepencies were s performed on the fuel injection	
Removed o	the 50 and the 100 ho and replaced the vac applies and applie	our lube items. cuum regulator filter and the d epoxy black prop paint ta	gyro central air filter. aft facina side of blades.		
Performed Complied v Removed,	a 30 day inspection o with the 90 day fuel si cleaned, and reinsta	of the battery, box and cable trainer/bowl cleaning and in:	es. Found no defects, stalled a new o-fing,	lbs of R134 Freon	
Cleaned g	round lead connection	on for inboard fuel sender. D ince Manual Chapter 28-40-	efueled right wing, perform	ned right wing fuel calibration per	
on the con Operation	trol column in accord ol checks were ok.	dance with the Piper PA32R-	301T maintenance manual	ht wings and adjusted the stops 27-10-00. Saftied as necessary.	
	d the stabilator cable of checks were ok.	es and saftied in accordance	e with the Piper PA32R-301	r maintennace manual 27-30-00.	
To Forward					

	VSP-163 Meggitt S-TEC SB 04-001 and SB 04-002R1 DNA by part number of autopilot computer installed (0) 192-12-68TF).
	VSP-142 Garmin SB 0204 DNA per VSP-142 and Garmin SB no. 0204. The Garmins have 2.11 version or newer installed.
	The left main tire is still ok for further operations and the left main gear alignment was adjusted and saftied in accordance with the piper PA32R-301T maintenance manual.
	Installed new left and right gear brake pads and torqued mounting botts.
	Checked left and right wings for fuel leaks. No leaks noted.
	Serviced all fluids and pressures.
	Performed an operational and leak check, as needed, on the above listed items, and no discrepancies were noted. This work was done per the Piper PA-32R-301T series maintenance manual.
	The work identified above was performed in accordance with the current Federal Aviation Regulations and was found to be airwarthy for return to service. Fertinent details are on file at this agency under;
	I certify that this aircraft has been inspected in accordance with an Annual Inspection and was determined to be in an airworthy condition. Pertinent details on file at filts agency under the condition of the c
_	MAYDAY AVIONICS, INC. DATE: 8-15-06 REPAIR STA: YXXR387Y Certified Altimeter, Transponder, Static System & En-
	coder I.A.W. 91.411 & 91.413. System complies with paragraph (c), appendix E, of Part 43. Certified to 20,000 feet.
_	coder I.A.W. 91.411 & 91.413. System complies with paragraph (c), appendix E, of Part 43. Certified to

	-	ORTHER	NAIR	N 989SR Hobbs: 175.8	-
	Airframe log book entry Make: <u>Piper</u>	Date: 8/22/2006 Model: PA-32R-3011	Serial No: <u>3257268</u>	Airframe Total Time: 175.8 Landings:	
	Performed an annual inspection of the control of th	tilan on this airframe per ti ad functional checks norm	ne Piper PA32R 301/301T Mai adi.	ntenance Manual, Chapter 5-20-	
-	Performed annual ELT Inspec	ction and operational che	cks per FAR 91.207(d). The E	LT battery expires SEPT of 2007.	}
-	gasket, torqued and safetle	d, Ilnes IAW AD2002-26-01 ar	nd SB 342D and no defects w	oted. Reinstalled screen with new vere noted.	
-	Tensioned rudder cable tens	sion per Piper PA-32R-301/	301T Maintenance Monual,	Chapter 27-20-00 and Figure 27-15.	1
-	check was ok.			g the geor and the operational	-
	Removed and replaced bo	th central and vacuum re	gulator filters.		
-	Removed nose wheel. Rem Installed in wheel. Installed	oved old bearings, presse wheel on axel.	d out races and pressed in r	new. Lubricated new bearings and	
-	This work was done per the	Piper PA-32R-301/301T ser	les maintenance manual.	and no discrepancies were noted.	
	The work identified above v	as performed in accorda	nce with the current Federa	Aviation Regulations and was	-
-	found to be airwarthy for re	turn to service. Perfinent	details are on file at this ager	ction and was determined to be	
	in an airworthy condition. F	s been inspected in according to the city.	as agency and a line of the second		
-	Work Order # 45191	Signed: Chris Allchin		for CR\$ N81R812N and Rapids, MI. 49588-8380	
_					
Carry	Forward	**			

Registration	No
--------------	----

		oper operation and to en
turn to service. Pertinent de 936.	etails of the work p	
DATE 8-21-06	MAKE Piper	MODEL PA-32R-301
S/N 3257268	N# N989SR	HOBBS 175.8
	N# N989SR	HOBBS 1/5.8
	B-21-06 for perinth their respective installationard systems or equipment of the with current FAA regulation to service. Pertinent de 1936.	

Date	Aircraft		Recorder	Maintenance	and Remarks		Signature	Certificate N
Date N 989SR	This Date Brought Forward	Total Mountai , Airport Roac (30-	n Air Repair L.L 1, Box 109 Willia 4) 464 - 4996.	C.	Mountain A Rt. 31, Airpo Williamstov (304)	Air Repair L.L.C. ort Road, Box 109 own, WV. 26187) 464-4996 089SR	Date 2-Apr	il-07
Name.	1 1101	d replaced with		3 battery serial number GO2281438.	6.00-6, 8 ply tires, and remove & repla Airstop 6.00-6 tubes. Remove & repla tire. Checked brake lining, clean & repla John H. Adams A&P 2882953 Charkes J. Burroughs A&P 23670889	lace tubes in left & lace nose tire with pack all wheel bear	right tires With AIR HAWK 5.	Michelim

MIKCIONI LOS

	331-009-1100	
Northern Air Inc. P.O. Box 888380, Gerald R, Ford Int'l Airport, Grand Rapids, Mi. 49588-8380 Airframe log book entry Date: 5/9/2007 Make: Piper Model: PA-32R-3011 Serial No: 3257268 Hobbs: 291.5	Model: PA32 Reg. No.: N989SR Tach Time: 2.90 Interpret Model: PA32 Reg. No.: N989SR T	0102 83
Performed a 100 hr / annual inspection on the airframe in accordance with the Piper PA-32R-301/301T maintenance manual inspection checklist. Lubed aircraft in accordance with the 50 and 100 hour lube schedule. Performed an annual inspection on the ELT per FAR 91.207(d), no defects were noted at this time. Battery due date September 2007. Complied with Lycoming SI 1492C oil suction screen inspection - no contamination found. Complied with AD2002-26-01 inspection of fuel injection lines and clamps as per Lycoming Service Bulletin 342D no defects noted	I LOG BOOK ENTRY (4/4)	REPLACEMENT DATE
Removed and replaced vacuum regulator filter. Visually inspected central filter, no defects noted. Performed annual fire extinguisher weight check found to be with in limits ok for service Removed and replaced left main brake disc, torqued hardware, reinstalled wheel and safetied. Removed and replaced left wheel outboard seal retainer ring. SB 1180 V- Band exhaust clamp. Inspected per SB 1180 no defects noted.	Zenith Flight Support 6741 Gemende Dr. Riverside, CA 92504 951-689-1160	
Performed an operational and leak check, as needed, on the above listed items, and no discrepancies were noted. This work was done per the Piper PA-32R-301/301T maintenance manual. The work identified above was performed in accordance with the current Federal Aviation Regulations and was found to be airworthy for return to service. I certify that this aircraft has been inspected in accordance with an Annual Inspection and was determined to be in an airworthy condition this date. Pertinent details are on file at this agency under: Work Order # 46385 Signed: Wayne Bishop For CRS N81R812N	Make: Piper Date: 01/08/08 00:00 Removed and replaced alternator in op switch P/N: 38905-003 IAW Piper Service Manual. Certified Repair Station #Y8ER561Y	
Total To Carry Forward		

Zemiin 6741 Gemende Dr. Riverside, CA 92504 951-689-1160 Flight Support

Certificate No.

	Aircraft Time		Recorder	Maintenance
Date	This Date	Total	Reading	Maliterance
	Zenith	6741 Gem Riverside, 951-689-1	CA 92504	
Make: Piper Date: 01/11/08 (A32R-301T S/N:	Reg. No.: N989SR Tach Time: 2.90	
Removed and re Piper Service M	eplaced alternator in anual. Certified Rep	op switch P/N: air Station #Y8	38905-003 IAW ER561Y	
otal To			+	
otal To arry Forward				

Registration	No
--------------	----

and Remarks	Signature	Certificate No.
Zenth Flight Support 6741 Gemende Dr. Riverside, CA 92504 951-689-1160 Make Piper Model: PA32R-301T Tach Time: 2.90 Fillmoved and replaced battery with new P/N:G-243 S/N:G02376421 IAW Oill Bervice Manual. Ops check good. Certified Repair Station For Example 1. September 1.		

	Aircraf	t Time	Recorder	Maintenance
Date	This Date	Total	Reading	Maintenance
	Model: PA326 S/N:	6741 Gemende Riverside, CA 92 951-689-1160 R-301T Reg T	Dr. 2504 J. No.: N989SR ach Time: 2.90 DVR 300i	
Total To Carry Forward				

Registration	No

Remarks	Signature	Certificate No
Zenth Flight Support 5741 Gemende Dr. Riverside, CA 92504 951-689-1160 1ake: Piper Miodel: PA-32R-301T Reg. No.: N989SR ate: 01/21/08 00:00 S/N: 3257268 Hobbs Time: 384.90 emoved and replaced Voltage Regulator with new P/N:68804-007 //N:Fo73506 IAW Piper Service Manual. Ops check good. Certified epair Station #Y8ER561Y		

MAKE: PIPER MODEL: PA-32R-301T S/N: 3257268 REG. NO: 989SR WORK ORDER: 4457-04-2008

HIGH PERFORMANCE AIRCRAFT, INC.

Repair Station No. HPFR569X 1850 JOE CROSSON DRIVE

DATE: 5/2/2008 A/C TSN: 385.9 HOBBS: 385.9

El Cajon, CA 92020 Phone: 858-576-5000

	=
lo f	

COMPLETED AN ANNUAL INSPECTION IN ACCORDANCE WITH FAR PART 43, APPENDIX D, USING CURRENT PA32R-301/301T (SARATOGA II HP/ITC) MAINTENANCE MANUAL 5-20-00 CHECKLIST AS A GUIDE. ALL AD'S CHECKED THRU REV 2008-09, SEE ATTACHED LIST INSPECTED THE ELT SYSTEM AND FOUND THAT IT MEETS THE REQUIREMENTS OF FAR 91.207(d) ON THIS DATE. ELT BATTERY EXPIRES FEBRUARY, 2010 COMPLIED WITH PIPER SB 1048 BY LUBRICATING CABLES WITH AEROSHELL 33 AS INSTRUCTED COMPLIED WITH PIPER SB 1134 (SERVO METERED FUEL PRESSURE PORT LEAKAGE - PRECISION BULLETIN PRS-105-N/A BY FUEL SERVO SERIAL NUMBER (70264409) COMPLIED WITH PIPER SB 1141 (CLIP NUT REPLACEMENT)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1151E (4130N STEEL HARDNESS DISCREPANCY)- N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1151E (4130N STEEL HARDNESS DISCREPANCY)- N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 11628 (EUROPEAN REQUIREMENTS FOR AVIDYNE ENTEGRA EQUIPPED PA-22 AND PA-32 MODEL AIRCRAFT)-N/A- AIRCRAFT NOT EQUIPPED WITH AVIDYNE SYSTEM COMPLIED WITH PIPER SB 1171 (STORMSCOPE ERRONEOUS STRIKE INDICATION)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1187 (VOLTAGE SUPPRESSOR REPLACEMENT), N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1191 (DISTRIBUTION OF PRECISION AIRMOTIVE SERVICE BULLETIN PRS-107, REV. 1), N/A BY AIRCRAFT SERIAL NUMBER MON NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-172 (DISTRIBUTION OF FAVIDYNE SERVICE BULLETIN NO. 569)-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SB 06-001)-N/A BY SERVICE BULLETIN PIPER VSP-176 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SB 06-001)-N/A BY SERVICE BULLETIN SB 06-0010-N/A BY SERVICE BULLETIN SB 06-0010-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-178 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SB 06-0010-N/A BY SERVICE SERVICE BULLETIN SB 06-0010-N/A BY SERVICE SERV	Airframe Entries	ince
THRU REV 2008-09, SEE ATTACHED LIST INSPECTED THE ELT SYSTEM AND FOUND THAT IT MEETS THE REQUIREMENTS OF FAR 91.207(d) ON THIS DATE. LIT BATTERY EXPIRES FEBRUARY, 2010 COMPLIED WITH PIPER SB 1134 (SERVO METERED FUEL PRESSURE PORT LEAKAGE - PRECISION BULLETIN PRS-105)-N/A BY FUEL SERVO SERIAL NUMBER (70264409) COMPLIED WITH PIPER SB 1141 (CLIP NUT REPLACEMENT)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1151 (4130N STEEL HARDNESS DISCREPANCY)- N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 11612 (4130N STEEL HARDNESS DISCREPANCY)- N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 11628 (EUROPEAN REQUIREMENTS FOR AVIDYNE ENTEGRA EQUIPPED PA-28 AND PA-32 MODEL AIRCRAFT) -N/A- AIRCRAFT NOT EQUIPPED WITH AVIDYNE SYSTEM COMPLIED WITH PIPER SB 1171 (STORMSCOPE ERRONEOUS STRIKE INDICATION)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1187 (VOLTAGE SUPPRESSOR REPLACEMENT), N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1191 (DISTRIBUTION OF PRECISION AIRMOTIVE SERVICE BULLETIN PRS-107, REV. 1), N/A BY AIRCRAFT SERIAL NUMBER AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-172 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SO 6-001)-N/A BY SERVICE BULLETIN NO. 5699-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SO 6-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SO 6-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-186 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SO 6-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-176 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SO 6-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-186 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SO 6-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-186 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SO 5-1040006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-186 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SO		
REQUIREMENTS OF FAR 91.207(d) ON THIS DATE. ELT BATTERY EXPIRES FEBRUARY, 2010 COMPLIED WITH PIPER SB 1048 BY LUBRICATING CABLES WITH AEROSHIELL 33 AS INSTRUCTED COMPLIED WITH PIPER SB 1134 (SERVO METERED FUEL PRESSURE PORT LEAKAGE - PRECISION BULLETIN PRS-105)-N/A BY FUEL SERVO SERIAL NUMBER (70264409) COMPLIED WITH PIPER SB 1141 (CLIP NUT REPLACEMENT)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1151E (4130N STEEL HARDNESS DISCREPANCY)- N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 11628 (EUROPEAN REQUIREMENTS FOR AVIDYNE ENTEGRA EQUIPPED PA-28 AND PA-32 MODEL AIRCRAFT) -N/A- AIRCRAFT NOT EQUIPPED WITH AVIDYNE SYSTEM COMPLIED WITH PIPER SB 1171 (STORMSCOPE ERRONEOUS STRIKE INDICATION)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1187 (VOLTAGE SUPPRESSOR REPLACEMENT), N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1191 (IDSTRIBUTION OF PRECISION AIRMOTIVE SERVICE BULLETIN PRS-107, REV. 1), N/A BY AIRCRAFT SERIAL NUMBER AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-172 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SD 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SB 06-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN O7-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN O7-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLI		
SB 1048 BY LUBRICATING CABLÈS WITH AEROSHELL 33 AS INSTRUCTED COMPLIED WITH PIPER SB 1134 (SERVO METERED FUEL PRESSURE PORT LEAKAGE - PRECISION BULLETIN PRS-105,N/A BY FUEL SERVO SERIAL NUMBER (70264499) COMPLIED WITH PIPER SB 1141 (CLIP NUT REPLACEMENT)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1151E (4130N STEEL HARDNESS DISCREPANCY)- N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1151E (4130N STEEL HARDNESS DISCREPANCY)- N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1162B (EUROPEAN REQUIREMENTS FOR AVIDYNE ENTEGRA EQUIPPED PA-28 AND PA-32 MODEL AIRCRAFT) -N/A- AIRCRAFT NOT EQUIPPED WITH AVIDYNE SYSTEM COMPLIED WITH PIPER SB 1171 (STORMSCOPE ERRONEOUS STRIKE INDICATION)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1187 (VOLTAGE SUPPRESSOR REPLACEMENT). N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1191 (DISTRIBUTION OF PRECISION AIRMOTIVE SERVICE BULLETIN PRS-107, REV. 1). N/A BY AIRCRAFT SERIAL NUMBER AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SO 60-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SO 60-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF EVCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF EVCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN O7-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF EVCOMING SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH PIN SW10-96 ADJUSTED RUDDER CABLE TENSION IAW MM 27-20-00		
METERED FUEL PRESSURE PORT LEAKAGE - PRECISION BULLETIN PRS-105)-N/A BY FUEL SERVO SERIAL NÚMBER (70264409) COMPLIED WITH PIPER SB 1141 (CLIP NUT REPLACEMENT)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 11518 (EUROPEAN REQUIREMENTS FOR AVIDYNE ENTEGRA EQUIPPED PA-28 AND PA-32 MODEL AIRCRAFT) -N/A- AIRCRAFT NOT EQUIPPED WITH AVIDYNE SYSTEM COMPLIED WITH PIPER SB 1171 (STORMSCOPE ERRONEOUS STRIKE INDICATION)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1187 (VOLTAGE SUPPRESSOR REPLACEMENT). N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1181 (DISTRIBUTION OF PRECISION AIRMOTIVE SERVICE BULLETIN PRS-107, REV. 1). N/A BY AIRCRAFT SERIAL NUMBER AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF AVIDYNE SERVICE ALLERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF SERVICE BULLETIN NO. 569)-N/A BY ENGINE MODEL (-AH14) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (N/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW MM 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNO		
COMPLIED WITH PIPER SB 1151E (4130N STEEL HARDNESS DISCREPANCY)- N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1162B (EUROPEAN REQUIREMENTS FOR AVIDYNE ENTEGRA EQUIPPED PA-28 AND PA-32 MODEL AIRCRAFT) -N/A- AIRCRAFT NOT EQUIPPED WITH AVIDYNE SYSTEM COMPLIED WITH PIPER SB 1171 (STORMSCOPE ERRONEOUS STRIKE INDICATION)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1187 (VOLTAGE SUPPRESSOR REPLACEMENT). N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1191 (DISTRIBUTION OF PRECISION AIRMOTIVE SERVICE BULLETIN PRS-107, REV. 1), N/A BY AIRCRAFT SERIAL NUMBER AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-172 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF EVCOMING SERVICE BULLETIN NO. 569)-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SD 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT PREMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE FOR BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE FOR BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE FOR		
COMPLIED WITH PIPER SB 1162B (EUROPEAN REQUIREMENTS FOR AVIDYNE ENTEGRA EQUIPPED PA-28 AND PA-32 MODEL AIRCRAFT) -N/A- AIRCRAFT NOT EQUIPPED WITH AVIDYNE SYSTEM COMPLIED WITH PIPER SB 1171 (STORMSCOPE ERRONEOUS STRIKE INDICATION)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1187 (VOLTAGE SUPPRESSOR REPLACEMENT), N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1191 (DISTRIBUTION OF PRECISION AIRMOTIVE SERVICE BULLETIN PRS-107, REV. 1), N/A BY AIRCRAFT SERIAL NUMBER AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-172 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN NO. 569)-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-98 ADJUSTED RUDDER CABLE TENSION IAW MM 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND	(70264409) COMPLIED WITH PIPER SB 1141 (CLIP NUT REPLACEMENT)-N/A BY AIRCRAFT SERIAL NUMBER	
MODEL AIRCRAFT) -N/A- AIRCRAFT NOT EQUIPPED WITH AVIDYNE SYSTEM COMPLIED WITH PIPER SB 1171 (STORMSCOPE ERRONEOUS STRIKE INDICATION)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1187 (VOLTAGE SUPPRESSOR REPLACEMENT). N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1191 (DISTRIBUTION OF PRECISION AIRMOTIVE SERVICE BULLETIN PRS-107, REV. 1), N/A BY AIRCRAFT SERIAL NUMBER AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-172 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN NO. 569)-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW MM 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 668-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND	COMPLIED WITH PIPER SB 1151E (4130N STEEL HARDNESS DISCREPANCY)- N/A BY AIRCRAFT SERIAL NUMBER	
(STORMSCOPE ERRONEOUS STRIKE INDICATION)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1187 (VOLTAGE SUPPRESSOR REPLACEMENT). N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1191 (DISTRIBUTION OF PRECISION AIRMOTIVE SERVICE BULLETIN PRS-107, REV. 1). N/A BY AIRCRAFT SERIAL NUMBER AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-172 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN NO. 569)-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F (F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW MM 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND		
(VOLTAGE SUPPRESSOR REPLACEMENT), N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER SB 1191 (DISTRIBUTION OF PRECISION ARMOTIVE SERVICE BULLETIN PRS-107, REV. 1), N/A BY AIRCRAFT SERIAL NUMBER AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-172 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN NO. 569)-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SV10-96. ADJUSTED RUDDER CABLE TENSION IAW M/M 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND		
(DISTRIBUTION OF PRECISION AIRMOTIVÉ SERVICE BULLETIN PRS-107, REV. 1). N/A BY AIRCRAFT SERIAL NUMBER AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-172 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN NO. 569)-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW M/M 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND		
AND NO WORK PERFORMED SINCE AUGUST 22, 2006 COMPLIED WITH PIPER VSP-172 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN NO. 569)-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW MM 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND		
SERVICE ALERT SA-05-001)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-174 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN NO. 569)-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F (F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW M/M 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 668-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND		-
LYCOMING SERVICE BULLÉTIN NO. 569)-N/A BY ENGINE MODEL (-AH1A) COMPLIED WITH PIPER VSP-175 (DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVO SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96. ADJUSTED RUDDER CABLE TENSION IAW M/M 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND		
(DISTRIBUTION OF S-TEC SERVICE BULLETIN SB 06-001)-N/A BY SERVÓ SERIAL NUMBER COMPLIED WITH PIPER VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SV10-96 ADJUSTED RUDDER CABLE TENSION IAW M/M 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND		
VSP-182 (DISTRIBUTION OF AVIDYNE SERVICE BULLETIN 601-00006-067)-N/A BY AIRCRAFT SERIAL NUMBER COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 601-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SV10-96 ADJUSTED RUDDER CABLE TENSION IAW M/M 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND		
COMPLIED WITH PIPER VSP-183 (DISTRIBUTION OF AVIDYNE PFD MANDATORY SB 501-00006-075)-N/A-NON AVIDYNE EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB 577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-09-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW MM 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND		
577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150116) COMPLIED WITH PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SERVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQUIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW MM 27-20-00 RIGGING INSTRUCTIONS, TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW MM CHAPTER 12 CHARTS AND		
PIPER VSP-191 (DISTRIBUTION OF AVIDYNE SÉRVICE ALERT SA-08-001)-N/A, NON-AVIDYNE EQÚIPPED AIRCRAFT REMOVED OXYGEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (W/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 FSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW MM 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW MM CHAPTER 12 CHARTS AND	EQUIPPED AIRCRAFT COMPLIED WITH PIPER VSP-184 (DISTRIBUTION OF LYCOMING SERVICE BULLETIN SB	
REMOVED OXYĞEN BOTTLE FOR HYDROSTATIC TEST AT WESTAIR (Ŵ/O 343927). REINSTALLED SAME AFTER TEST. SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW M/M 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND	577/SKY-TEC SERVICE BULLETIN 07-01 REV C)-N/A BY STARTER SERIAL NUMBER F(F4P-150115) COMPLIED WITH	
SERVICED BOTTLE TO 1850 PSI WITH NO LEAKS FOUND. NEXT TEST DUE MAY, 2011 REPLACED STATIC WICK ON INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW M/M 27-20-00 RIGGING		
INBOARD LEFT FLAP WITH P/N SW10-96 ADJUSTED RUDDER CABLE TENSION IAW MM 27-20-00 RIGGING INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW MM CHAPTER 12 CHARTS AND		
INSTRUCTIONS. TENSIONS ARE WITHIN LIMITS AND OPERATE NORMALLY AT THIS TIME REPLACED RIGHT BRAKE SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW MM CHAPTER 12 CHARTS AND		
SHIM WITH P/N 068-01100 PERFORMED NORMAL AND EMERGENCY LANDING GEAR OPERATIONS, NO ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW MM CHAPTER 12 CHARTS AND		
ABNORMALITIES NOTED AT THIS TIME LUBRICATED AND SERVICED AIRCRAFT IAW M/M CHAPTER 12 CHARTS AND		

The aircraft and/or component(s) indentified above	e was repaired and inspected in accordance with current maintenance rules of the Federal Aviation
Regulations and is approved for return to service.	Pertinent details of this repair are on file at this repair station under Work Order No. 4457-04-2008
Dated	1 1 201

DA	TE:	5/2/	2008

Dan Salzman Certified Repair Station No. HPFR569X

Printed by EBis 3 (datcomedia.com)

Work Order: 4457-04-2008

Signature	Certificate No.
	Signature I bearings checked s on run

AIRCRAFT L	OG.
------------	-----

Date	AFFORDABLE AVIONICS INC. CRS # 8AAR592Y
	THE ALTIMETER, STATIC SYSTEM, TRANSPONDER AND
	AND HAVE BEEN FOUND TO COMPLY WITH FAR 91.411 AND
	413 AND APPENDIX E AND F OF FAR 43 W 19 # 90 31
	A/C REG NO N 96952 TACH/HOBBS TIME 435.9
	ALTIMETER #1 MODEL # 5934 PD-3 SN 450 376
	ALTIMETER #2 MODEL # N /A S/N N /A TXDR # 1 MODEL # 67 7 × 32 7 S/N 8 3 7 0 8 1 2 6
	TXDR #2 MODEL# N/A S/N N/A
	DATE OF TEST 2/9/09 INSPECTOR
	Airframe N989SR PA32R-301T S/N 3257268
	Date 4/1/2009 TTSN 447.8
	TOMO!
	TACH IVA
	Replaced vac regulator filter, replaced engine inlet air filter, serviced
	compass with fluid, reconnected wire to stall warning horn, serviced
	brake reservoir with hydraulic fluid, serviced and charged aircraft battery,
	installed missing rudder cable attach bushings and rigged rudder per
	m/m and lubed aircraft per m/m. I certify that this aircraft has been
	inspected in accordance with an annual inspection and found to be in an
al To	airworthy condition.
rry Forward	Il bonk
	SIGNED from 10/100
	Kevin Booth A&P 2764111 I .A.

Registration	No

and Remarks	Signature	Certificate No.
Airframe N989SR PA32R-301T S/N 3257268 Date 6/16/2009 TTSN 478.0 TACH N/A TSMOH		
SIGNED Brian Booth A&P 2773972		
Airframe N989SR PA32R-301T S/N 3257268 Date 9/24/2009 TTSN 493.4 TACH N/A TSMOH HOBBS 493.4 TSPOH Serviced aircraft battery and tires to spec.	•	
Brian Booth A&P 2773972		

This Date				
Title Date	Total	Reading		Maintenance
HOBBSReplaced ELT batte (d)- ok a aircraft ha	5/5/2010 N/A 558.1 vac regulator ry (next due nd replaced as been insper and found to	TT TS TS filter, replaced Aug 2012) and ELT antenna. cted in accorda be in an airwo	MOH gyro filter, replaced tested per 91.207 I certify that this ince with an annual of the condition.	
Date 10 TACH N/	/29/2010 A 0.9	TTSN TSMC TSPC	DH	
	Airframe Date TACH HOBBS Replaced ELT batte (d)- ok a aircraft ha inspection SIGNED Airframe Date 10 TACH HOBBS 61 Serviced and aircraft. SIGNED	Airframe N989SR P. Date 5/5/2010 TACH N/A HOBBS 558.1 Replaced vac regulator ELT battery (next due (d)- ok and replaced aircraft has been inspecinspection and found to SIGNED Kevin Bootl Airframe N989SR P. Date 10/29/2010 TACH N/A HOBBS 610.9 Serviced and charged neaircraft. SIGNED Armonia	Airframe N989SR PA32R-301T S/ Date 5/5/2010 TT TACH N/A TS HOBBS 558.1 TS Replaced vac regulator filter, replaced ELT battery (next due Aug 2012) and (d)- ok and replaced ELT antenna. aircraft has been inspected in accorda inspection and found to be in an airwork SIGNED Kevin Booth A&P 2764111 Airframe N989SR PA32R-301T S Date 10/29/2010 TTSN TACH N/A TSMO HOBBS 610.9 TSPO Serviced and charged new G-243 battery aircraft. SIGNED	Airframe N989SR PA32R-301T S/N 3257268 Date 5/5/2010 TTSN 558.1 TACH N/A TSMOH Replaced vac regulator filter, replaced gyro filter, replaced ELT battery (next due Aug 2012) and tested per 91.207 (d)- ok and replaced ELT antenna. I certify that this aircraft has been inspected in accordance with an annual inspection and found to be in an airworthy condition. SIGNED Kevin Booth A&P 2764111 I.A. Airframe N989SR PA32R-301T S/N 3257268 Date 10/29/2010 TTSN TACH N/A TSMOH HOBBS 610.9 TSPOH Serviced and charged new G-243 battery and installed in aircraft.

ificate No.

D	Aircraft	Time	Recorder		44 * 4
Date	This Date	Total	Reading		Maintenance
	STATIC SYSTEM TO 91.411 AND 91.413 BEEN FOUND TO ALTIMETER PIN STANSIALTIMETER AND BE DATE: 4-17- W/O: 2335 S	ESTS AND INSPE HAVE BEEN PERI O COMPLY WITH 1934PD-3 PONDER MODEL ENCODER TESTE 12 A/C TAK SIGNATURE:	LIDE REPORTING EQUICITIONS AS REQUIRE CORMED AND THE SY APPENDIX E AND FOR ALTIMETER S/N 4 CTX 327 DTO 20,000 SH OR HOBBS: 20,000 SH CR S# V4WR915X	D BY 14 CFR, STEMS HAVE DF PART 43.	
	+ +		+		
	-		-		

Registration No. Certificate No. Signature and Remarks NorthStar Aircraft Maintenance 5600 N Hwy 95, Bldg H100 Lake Havasu City, AZ 86404 Ph:(928) 764-1999 Aviotion Services LLC Date: 5/30/2012; Aircraft: N989SR; Type: PA32R-301T; S/N: 3257268; Hobbs: 732.30; Total Time:; Engine - Type: , S/N: Shop Order #: HII-12-0741, Closed: 4/19/2012 C/W Annual inspection per FAR 43, Appendix D. and Piper PA32R-301/301T MM. Annual inspection consist of pre and post-inspection ground runs, airworthiness directive research, removal and reinstallation of inspection panels and interior, inspection of aircraft, servicing airframe and engines. Inspected ELT per FAR 91.207(d) installed new 110-4 battery pak, Expires Oct 2013. Performed hydrostatic check Oxygen bottle and serviced. Next due 04/2015. Resealed left and right brake calipers and bled system. Installed 2ea new 068-01100 brake isolators. Cleaned induction air filter. Retensioned rudder, aileron, elevator and elevator trim cables. Installed new receiver/dryer and high pressure discharge line to compressor. I certify that this aircraft was inspected I.A.W. an Annual Inspection and was determined to be in an Airworthy Condition.

A	IRC	RAI	1	LOC

Date	Aircraf	t Time	Recorder	
D018	This Date	Total	Regiding	Maintenance
Shop Order #	5600 N Hwy 95 Lake Havasu C	ity, AZ 86404 899 ; Type: PA32R- e and septiced.	801T; S/N: 3257268	
MAKE: Piper MODEL: PA-32R: S/N: 3257268 REG. NO: 989SR WORK ORDER: 23330-07-2012	-301T HOWARD A	d Carrier	Howard Aviation, Inc. Repair Station No. TO3R874L 1401 Fairplex Drive La Veme, CA 91750 Phone: 909-593-2596	DATE: 7/23/2012 A/C TSN: HOBBS: 759.4
Airframe En	tries			-
	re and disassembled who eelR&R both brake disc		e and installed new tube. Inflated tirew.	re to 38 psi. Reassembled and
Manual and the F	ederal Aviation Regulations	under which the oper		e current Howard Aviation, Inc. inspection irn to service as per those requirements.
Pertinent details (// ~ - /	

-	1 1	-17	11.	1211	r. 13	
		6 411	DH F	шп	IUI	1 1 1 1

and Remarks	Signature	Certificate No.
I CERTIFY THAT THE ALTIMETER, ENCODING SYSTEM AND STATIC SYSTEM TEST REQUIRED BY FAR 91.411 HAVE BEEN PERFORMED: THE ALTIMETER: PILOTS S/N COPILOTS S/N ADC S/N ADC S/N WAS/WERE TESTED TO K FT I CERTIFY THAT THE TRANSPONDER TEST REQUIRED BY FAR 91.413 HAS BEEN PERFORMED AND FOUND TO COMPLY XPDR # 1 M/N 61X 33 S/N 24144462 XPDR # 2 M/N S/N ADTE DATE DATE DATE DATE TOMLINSON AVIONICS OF FLORIDA, INC. 521 DANLEY DR., FT. MYERS, FL. 33907 FAA CRS # V6TR097X		

Tomlinson Avionics of Florida, Inc. 521 DANLEY DRIVE FORT MYERS, FL 33907 V6TR097X LOG ID# 90 17-September-2012 WO# 87805

N989SR S/N 3257268 PIPER PA-32R-301T

Pg 1 /

RIMOVED S-TEC HSI SYSTEM AND INSTALLED GARMIN G500 PER STC#SA02015SE-D. REMOVED GNS530, AND GNS430 AND INSTALLED 2-GARMIN GTN750'S PER STC#SA02019SE-D. INSTALLED GARMIN TRAFFIC SYSTEM GTS800 PER STC#SA02016SE-D. REMOVED S-TEC A/H AND REPALCED WITH RD ALLEN RCA22-7 A/H. REMOVED GMA340 AND INSTALLED GMA35. REMOVED ARTEX ELT AND INSTALLED KANNAD 406MHZ ELT. INSTALLED WX500 STORMSCOPE INSTALLATION DRAWINGS. REMOVED GARMIN GTX327 TRANSPONDER AND INSTALLED GARMIN GTX330.

Signed Phillip Tomlinson

117/12

		AIF	RCRAFT LOG			1	registration No.	4	
Date	Aircro	ift Time	Recorder Reading	Maintena	ince	and Remarks		Signature	Certificate No.
521 DANLEY DE LOG ID# 91 17-S N989SR S/N 32		S, FL 33907 V6TE		" IA#30212	Pg 1/1	LOG ID# 8028 30-January-20	ES 601 HUMPHRIES AVE. ORLAN 13 WO# 113795 HOBBS 883.5 PER PA-32R-301T	DO EXECUTIVE AIRPORT O	RLANDO, FL Pg 1/1
				STC#SA01435SE. ALL GND AND FLI CE FOR FURTHER DETAILS.	GHT	REMOVED AIRCRAFT PROPELLER. 37819774-472 WITH NEW. INST. BOLTS TORQUED AND SAFETY WI OPERATIONAL CHECKS GOOD. AP 3479939 BRANCEY E. DANIE	REPLACED ALTERNATOR BELT P/N: 370 ALLED NEW PRP-909-6 PROP O-RING. RED IN ACCORDANCE WITH MANUFACTURE	022355 AND A/C COMPRESSOR B PROPELLER ASSEMBLY INSTALL ERS SPECIFICATIONS. ENGINE	ELT P/N: ED; MOUNTING RUN-UP AND
1/13/12	# 830.7	Replace	2 RTM	infice with Flight Custum	n III	AP 3479939 BRANLEY E. DANIE	LS Date	1	1
		600x6 8p	y inflagh To	38 psi Installed stop as	sembly				
		PN 37970.	2 For Nose	gent opps check good.		-			-
				JNSD AND 2862	S31				-
						-			-
Total To Carry Forward					- 1				
•		1				U	(b) (c)		

	18.		
A 1	DIC DA	ET	100
AI	ACAM	rı.	LUG
. 4.	. Mar. 18 .		

Date	Aircraft Time		Ricorder	M-1-1		
Date	This Date	Total	Reading	Maintenance		
0/13/2013	Brought Forward	COMP	LIED WIT	H AN ANNUAL INSPECTION.		
HOBBS:	984.3	SERVICE	AIRCPAR	T BAT. INSPECTED ELT PER		
A.T.T	984.3	FAR 91-20	(d) ELT B	SAT. DUE 5/2018. CHECKED LIGHT		
		REPLACED	INDUCTION	MINFILTER, INSTITUTENT AND		
		VAC RELIE	F FILTERS	REPLACED ALL ENG. LORD MOUNT		
		LUBED MR	PRAME. L	UBED GEARS, CHECKED GEAR RE		
		& EXENS	ON. CHECK	ED EMALGY. GEAR EXT. REPLACED		
		THEL CAP !	SEALS . CHE	EXED N/C SIS. SERVICED 02 BOTTL		
		1 .66		NCE THEU 2013-11.		
			L. CALLING COMPANY	MIR CRAFT Me been		
Total To Carry Forward		49DACEON	and was	determined to be in		

	Registration No.		
and Remarks		4	

Switlik Aviation Maintenance, Inc.

Page Field Airport (FMY) 207 Danley Drive

Fort Myers, Florida 33907

734 936-3666 www.switlikaviation.com S.M.OH. Page T.T. Hobbs S./N. Date Reg. No. 1135.8 1/7/2014 1135.8 3257268 N9895R

Installed new Goodyear 600x6-8FCIII tire on RH main wheel. I have inspected these repairs and have found them to be in airworthy condition.

Edward Switlik 1A2197076

Switlik Aviation Maintenance, Inc.

Page Field Airport (FMY) 207 Danley Drive

Fort Myers, Florida 33907

239-936-3666 www.switlikaviation.com

| Date | Hour meter | Total time | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- | --- |

Lubed landing gear. Lube flight controls. Greased wheel bearings. Checked landing gear normal and emergency operation. Serviced tires, battery, brakes, and hydraulic fluid. Replaced alternator inop. Switch. Replaced instrument air and vacuum relief filters. Serviced air conditioner. Inspected ELT per 91.207 (d), battery due 05/2018. I have inspected this aircraft in accordance with an annual inspection and find it to be in airworthy condition.

I certify that the above stated maintenance and/or inspection was performed in accordance with the current regulations of the Federal Aviation Administration and the aircraft identified above is presently approved for return to service.

John A Richardson 262536133 IA

Total To
Carry Forward

and Remarks	Aircraft Lo	g	
	Date: 09/30/2014 IIOBBS: 11690.5 WO: A001310 Work accomplished: ICA'S have be MAINTENANCE RELEASE: This aim or appliance was repaired and inspec of the Federal Aviation Administration All work was performed in accordance appliance maintenance manuals and file at the repair station office.	Reg.#: N989SR Aircraft S/N 3257268 een reviewed and are current at this time. craft, airframe, aircraft engine, propeller, ted in accordance with current regulations and is approved for return to service.	Certificate N
			1

Date: Hobb Repla ran gi Co-Pi Adjus	s: 1169.6 PA iced hydraulic pump T-file ear in normal and emerge flots yoke bushing "O" rice sted rudder cable tension	32R-301 tting, installed P/N A gency configuration p ng, installed P/N MS n per Piper PA32R-3	N 989SR Aircraft SN: 3257268 N918-1D Serviced hydraulic pump reservoir and per PA32R-301T MM 29-10-00. Replaced 128775-218 per PA32R-301T MM 20-00-00.	= -
was Adm appl deta	repaired and inspected in instration and is approvicable aircraft, engine arills are on file at the repaired.	ed to return to serviced or appliance main ir station office, WO	ne, aircraft engine, propeller or appliance identified current regulations of the Federal Aviation ce. All work was performed in accordance with atenance manuals and instructions. Pertinent # S001820 CRS # ECWR470D ch, FL 32961 (772) 562-9257	-
Total To Carry Forward				

	Registration No.		
NIN AVIATION INC	Vere Bosch El (VDR)		0.
ate: 10/23/14	., Vero Beach, FL (VRB) AIRCRAFT LOG	N 989SR	-
obbs: 1169.8	PA32R-301	Aircraft SN: 3257268	
Secured right and le	ft wing root seals. Replaced uisher, installed P/N RT-A600	fuel pump switch light bulb, installed P/N GE 85. per Piper PA32R-301T MM 26-20-00, Tightened	-
ft and right fuel tan	k interconnect clamps. Reco	nnected cigarette lighter.	
as repaired and ins	pected in accordance with co	e, aircraft engine, propeller or appliance identified urrent regulations of the Federal Aviation e. All work was performed in accordance with	
policable aircraft, e	ngine and or appliance main the repair station office, WO	tenance manuals and instructions. Pertinent	-
ignature Aviation In	Municipal Airport, Vero Beac	CRS # ECWR470D	
oun Aviation, inc.	Mullicipal All port, Velo beac	11, 1 2 22 3 . (1 1 2) 3 2 2 2 2 2	

Registration No.

1.	Date: 10/21/2014 HOBBS: 1169.8 WO: A001338 Work Accomplished: Performed adjustment on magnetic con accordance with Piper maintenance manual 761-879 Sec. 34-20-0 1 thru 6.Systems checked normal. Updated compass card was a	npass in		Date
	MAINTENANCE RELEASE: This aircraft, airframe, aircraft engine, or appliance was repaired and inspected in accordance with current of the Federal Aviation Administration and is approved for return to all work was performed in accordance with applicable aircraft, enging appliance maintenance manuals and instructions. Pertinent details file at the repair station office.	regulations service.	This Date	Aircraft lime
	Signature: ECWD470D Sun Aviation, Inc. Municipal Airport, Vero Beach, FL 32961 (772) 5	662-9257	Total	1 lime
,	Aircraft Log		-	
	Date: 10/21/2014 Reg#: N989SR HOBBS: 1169.8 Aircraft S/N 3257 WO: A001338 Work Accomplished: The following Altimeter(s) , Altitude Encode Static Pressure System(s) have been tested in accordance with FA and conforms to FAR Part 43 Appendix E and F	-/-\ /	Reading	Recorder
	#1 ALT. Model: GDC74AS/N:20812245To: 20,000#2 ALT. Model: 5934PD-3S/N:402876To: 20,000#3 ALT. Model: N/AS/N:N/ATo: N/A	FT FT FT FT FT FAR 91.413 x F.		
	of the Federal Aviation Administration and is approved for return to a All work was performed in accordance with applicable aircraft, enging appliance maintenance manuals and instructions. Pertinent details file at the repair station office. Signature:	regulations service. le and or are on	Maintenance	
	Sun Aviation, Inc. Municipal Airport, Vero Beach, FL 32961 (772)	562-9257	9	

						and Remarks
				-		
			-			Sig
						Signature
						Certificat

ind Remarks		Signature	Certificate No
MAKE: Piper MODEL: PA-32R-301T S/N: 3257268 REG. NO: N989SR WORK ORDER: BA-00252-03-2015	Bartelt Aviation, Inc. 1301 West Lafayette Street Sturgis, MI 49091 Phone: 269-651-5431	DATE: 4/9/2015 A/C TSN: 1183 HOBBS: 1183	
Airframe Entries			
	ring limit placard and applied protective coating over p L G243 battery, SN G02859283.	placard Serviced and	
Maintenance Release			
The aircraft and/or componed Aviation Regulations and war No. BA-00252-03-2015, Daniel DATE: 4/9/2015	nent(s) on N989SR was repaired and inspected in accordance was found Airworthy for return to service. Pertinent details of the ated 4/9/2015. SIGNED:	ie repair are on the under work Order	
Aviation Regulations and w No. BA-00252-03-2015, Da	vas found Airworthy for return to service. Pertinent details of the ated 4/9/2015. SIGNED: SIGNAL A SALO	Work Order: BA-00252-03-2015	
Aviation Regulations and w No. BA-00252-03-2015, Da	vas found Airworthy for return to service. Pertinent details of the ated 4/9/2015. SIGNED: SIGNAL A SALO	Work Order: BA-00252-03-2015	
Aviation Regulations and w No. BA-00252-03-2015, Da	vas found Airworthy for return to service. Pertinent details of the ated 4/9/2015. SIGNED: SIGNAL A SALO	Work Order: BA-00252-03-2015	

Aircraft Time Recorder Date Maintenance This Date Reading Total DATE 5-13-15 S.O. 57198 MAKE www.maydayavionics.com N# Piper N989SR AVIONIOS 5500 44th St. St., Gereid R. Ford International Airport, Grand Rapas, Mt 49512 616-957-4920 PA-32R-301T MODEL S/N 3257268 HOURS 1203.8

Installed G500 System Software: GDU 620 Software Ver. 7.00 and GRS 77 Software Ver. 3.04 IAW the Garmin Software Service Bulletin No's: 1520, Rev A & 1524, Rev A.

Installed Main Software Ver. 5.13 and COM SW Ver. 2.13 to the dual Garmin GTN 750's and Audio Software Ver. 3.07 to the GMA 35 in accordance with the Garmin Service Bulletin No.'s: 1467, Rev A; 1466, Rev B; 1418, Rev A; 1406, Rev B, 1360, Rev A, and 1374, Rev A.

All items were ground checked in accordance with their respective manuals for proper operation and to ensure no adverse reactions occurred to other onboard systems or equipment. The above work was performed in accordance with current FAA regulations and in respect to work performed on the aircraft identified above is approved for return to service.

Tota

Registration No.____

and Dameste		
and Remarks	Signature	Certificate No.
3/1/2015 1234, 9 Hors.		
PERFORMED BUNUAL INSPECTION. AS COMPL	MUCE CHCEICES	7420664
8/1/2015 /NSPECTES ELT 12W 91.201- 9	marely mexa Do	2014
Chimis + inspieres nir pinnig; Replaces		
Ple rolmes Levelre pierrome Luse; services	ALL PLUIDS -	pecsoles.
Opeennoum euck norman. I cennay	フィタつ つないら かり	arrame 405
BELL INSPECTED IAW BY PUNUM INSPEC	17,W = W05	ETER MINES
70 BY IN M AIR WONING COMD. 17 100 1	7 7 U 1 5 71 NS	
54 Le 2 182821155 119		





719 Airport Drive Ann Arbor, MI 48108

Phone 734-662-6806 Fax 734-662-0559

JULY 31, 2015

N989SR

HOBBS: 1235.6

nce

Aircraft

REMOVED OXYGEN BOTLE FOR HYDRO STATIC TESTING, SYSTEM IS INOP, SEE POH FOR

CURRENT W&b

BRENDAN J. CECONE 3745798 A&P





719 Airport Drive Ann Arbor, MI 48108

Phone 734-662-6806 Fax 734-662-0559

AUGUST 7, 2015

N989SR Airframe

1242.4 HOBBS

Reinstalled oxygen bottle into aircraft after hydro static test. Bottle passed hydro static test. Leak checked system at 500 and 1000PSI then filled to 1850. bottle Life expires By JUNE 2016. operation of oxygen system was satisfactory.

Brendan J. Cercone 3745798A&P

Use w3 Balance Sheet dated Sept. 14, 2012

UStal bottle install 3745798 A3P 12-11

Total To
Carry Forward

MAKE: Piper MODEL: PA 32r-301T S/N: 3257268 REG. NO: N989SR WORK ORDER: 6941-09-2015

Sterling Aviation

145 John Glenn Drive Concord, CA 94520 Phone: 925-676-2100 DATE: 9/28/2015 A/C TSN: HOBBS: 1268.9

Airframe Entries

replaced left main landing gear tire with new p/n 606C86-6. inflated to spec. per p.o.h with no leaks noted.

DATE: 9/28/2015

SIGNED! Jamel Julian DO 316131

Work Order: 6941-09-2015

Printed by EBis 3 (datcomedia.com)

DATE: 9/9/20 14

HOBBS: 1377.6

N989SR

ANNUAL AIRCRAFT AS PER 43 (APPDEX: "D") SWING LANDING GEAR INSPECT AND LUBE AS REQ.. CHECK TIRES & BRAKES. INSPECT AND LUBE ALL FLIGHT CONTROLS AND LUBE AS REQ. CHECK ELT FAR 91.207 (D) ELT BATT DUE 5/1018. CHECK A/C SYSTEM & 02 SYSTEM. CHECK ALL AD'S FOR THIS AIRCRAFT THOUGH 9/9/2016 FOR THIS AIRCRAFT.

I CERTIFY THAT THIS AIRCRAFT WAS INSPECT IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.

JOHN P RUSSMAN

2784905 A/P I/A

	Aircra	ft Time	Recorder	
Date	This Date	Total	Reading	Maintenanc
LOG ID# 1036	AVIONICS & INST 14-November-20 N 3257268 PA-3		3679 Bowen Ro HOBBS 1401.8	ad Howell, MI 48855 YPCR724X Pg 1/
ACTION: Update software Versi	on 5.0 to 5.2 in	are Version 5.13 accordance with	to 6.24: Com SB # 1655 Rev.	011-02282-00 Serial#: 1ZA010594 software ver. 2.13 to 2.20 WAAS A dated Sept. 19, 2016.
ACTION: Update	ed GTN Main Softwa	are Version 5.13	to 6.24: Com	011-02282-00 Serial#: 1ZA011117 software Ver. 2.13 to 2.20 WAAS A dated Sept. 19, 2016.
CTION: Update Sootblock Code to 4.20A; GMA Data ver. 2.15	ver. 2.00 to 4.2 Configuration verse to 4.10; GMA Vor Rev. A dated Sep	e version 2.00 to 10A; GMA System o er. 4.20A loaded; ice Command ver.	o 4.20A; Aux Re Code ver. 3.10 ; GMA Aux Syste	11-02299-00 Serial#: 1T6005301 egion List ver. 2.00 to 4.10; Aux to 4.20A; Audio Configuration ver. 3.15 em Code 2.22 to 4.20A; GMA Aux Audio in accordance with Garmin Service
tal To arry Forward				

Registration No.____

and Remarks		Signature	Certificate No
MODEL: PA-32R-301T S/N: 3257268 REG. NO: N989SR WORK ORDER: BA-00444-05-2017 Airframe Entries Vacuumed A/C system	Bartelt Aviation, Inc. 1301 West Lafayette Street Sturgis, MI 49091 Phone: 269-651-5431 and serviced with R134a to spec's per Piper Sertional check of A/C system is good.	DATE: 6/13/2017 A/C TSN: 1436.3 HOBBS: 1436.3	
The aircraft and/or compo	nent(s) on N989SR was repaired and inspected in accordance found Airworthy for retugate to service. Pertinent details	ordance with current FARs rules of the Federal ails of the repair are on file under Work Order	
No. BA-00444-05-2017, D DATE: 6/13/2017	ated 6/13/2017. SIGNED: SIGNED	Work Order: BA-00444-05-2017	
	ated 6/13/2017.		
	ated 6/13/2017. SIGNED: SIGNED	Work Order: BA-00444-05-2017	
	ated 6/13/2017. SIGNED: SIGNED	Work Order: BA-00444-05-2017	
	ated 6/13/2017. SIGNED: SIGNED	Work Order: BA-00444-05-2017	

D	Aircraft	Time	Recorder	Maintenana
Date	This Date	Total	Reading	Maintenance
	REG N989SR The ATC transport found to comply very reporting equipment compliance of 91. I certify that the all	WO# 611 ader was tested with 91.413 P nt was tested 411 Part 43.1 timeter and s	Preferral INSTRUME INSTRUME INSTRUME INSTRUME IN INSTRUMENTAL INST	A47.4 (dash) Suc 2017 and atomatic altitude Luc 2017 in 1 (C) to 26 K Ft. ired by FAR
Total To Carry Forward				

1	Registration	No.			

and Remarks	Signature	Certificate No

PREFERRED AVIONICS AND INSTRUMENTS, LLC

3679 Bowen Road Howell MI 48855 800-736-6143 Office CRS# YPCR724X

MAINTENANCE RELEASE

This Aircraft Appliance/Component was repaired and inspected in accordance with current Federal Aviation Requirements and was found air worthy for return to service. Pertinent details of the repair are on file at this agency under:

W.O.No. 6112 Date: 27 June 2017

O/H Repair F/T

Removed Serviceable Rebuilt

Other

Unit: Air Data Coopused

Mfg.: Carlein

Model: GOC744 S/N 20612245

P/N 011-00062-10

Cust: JK AVIATION
Reg: N9893R

Tech.

Recorder Reading		Maintenance
rofe	erred	
INSTR	UMENTS	
YPCR724X		
2A/C T	IME: 1447.4 HABBS	
rt 43. Appendi and calibrated ppendix E, Pa atic system tes	d on 27 June 2017 and ix F. Automatic altitude on 27 June 2017 in tragraph (C) to 20 K Ft. its required by FAR as tested on 27 June 2017 to 20,000 Ft.	

Registration	No	
--------------	----	--

			Signature	Certificate No.
MAKE: Piper MODEL: PA-32R-301T S/N: 3257266 REG. NO: N989SR WORK ORDER: BA-00462-08-2017	Bartoli Avvation Inc.	Bartelt Aviation, Inc. 1301 West Lafayette Street Sturgls, MI 49091 Phone: 269-651-5431	DATE: 10/2/2017 A/C TSN: 1495.8 HOBBS: 1495.8	
Airframe Entries				
Filter and (1ea) R Selector Bowl Sci Operational Chec Free-fall System. test Reinstalled function check an form tracking nun	A-D9-18-1 Filtereen Inspection It of Landing G Serviced Hyd I Oxygen Bottle I installation on Inber 17-10255	a per the PA-32R-301T maintenance guideling. C/W 100hr Wheel Bearing Inspection and and Cleaning. C/W 100hr Landing Gear Libear per MM. Performed Operational Check Power Unit with 5606 CW FAR91.207 (d) assembly p/n 895-24050, s/n 29107 / 851 factory cylinder p/n H21507-02. (See C&L dated 9/13/2017) Oxygen cylinder DOM 06.	nd Servicing. C/W 90 day Fuel ubrication Items. Performed of Landing Gear Emergency ELT inspection and function after regulator inspection / L Aero CRS LOJR785Y 8130-3 /2017 (cylinder expires 06/2032).	
Service Bulletin 1 discrepancys four placard Perfort battery capacity to indicator p/n RCA	245A C/W Find C/W Pipe ned 30 day fire est per MFR re 22-7 s/n 212H	plied per AD 2013-02-13 Stabilator Control Piper SB 856 - Stabilator Attach Fittings Insp er SB 1280A - H3R Fire Extinguisher Decal extinguisher inspection and weight check commendations Serviced Oxygen to 180 474G. Installed St-By attitude indicator p/n	pection via visual inspection. No Requirement by installing Performed annual / 100 hour 10 PSI Removed St-By attitude 102-0041-04 s/n 24GR0101	
Cleaned and lubri Installed new nos Ch.12-20, adjuste bushings on nose	cated control y e tire p/n 505C d center torque steering belic	ers for Fuel Pump, LH Magneto, and RH Ma yoke shafts Installed (1ea) Nose Gear Up 66-5 and new tube p/n 092-308-0 Greas e link bolt Installed (1ea) p/n 452-445 bus rank. ngged steering and rudder control sys -00 and 32-20-00. Operational check of ste	Stop Bumper p/n 37970-005 ed nose gear torque links per MM shing and (1ea) 65003-015 stem per Piper PA-32-301/301T	
		mpener Tightened nose actuator to down		-
		1 of 2		

		Recorder	t Time	Aircraf	D
ance	Mainter	Reading	Total	This Date	Date
	Installed new Good Year FCIII RH main lled (8ea) p/n 066-06200 brake linings Torqued Both Wing Rear Spar Attachment leded Replaced Fuel Bowl "O" Ring led in Lower Cowl as needed Cleaned brace attachment bolts Performed QC ght tests.	Vheel Well Areas Installe inting screws to specs To ts floor foam board as need Heat Shielding p/n 189-446	leaned Main Gear V lower fuel tank mou aired center row sea d Worn and Missing Tightened and Re	tire p/n 606c86-6 C Retorqued all inboard bolts to specs Rep. With New Replace	
	ICE WITH AN ANNUAL INSPECTION AND WAS	TION.	AIRCRAFT HAS BEEN AIRWORTHY COND	I CERTIFY THAT THIS A	
	Work Order: BA-00462-08-2017	I ch	SIGNED:	DATE: 10/2/2017	
	Printed by EBis 3 (datcomedia.com)		Larry E. Russe	Drive. Torribore	
		2 of 2		<u>l</u>	
				18.	tal To

Registration	No
--------------	----

and Remarks	Signature	Certificate No

AIRCRAFT LOG		Registration No	
Recorder Reading	Maintenance	and Remarks Signature Cer	rtificate No.
Gear Wheel Well Areas Installed ink mounting screws to specs Torc ow seats floor foam board as neede fissing Heat Shielding p/n 189-446 i	in Lower Cowl as needed Cleaned e attachment bolts Performed QC	MAKE: Piper MODEL: PA-32R-301T S/N: 3257288 REG. NO: N989SR WORK ORDER: BA-00489-12-2017 Airframe Entries Bartelt Aviation, Inc. DATE: 3/5/2018 AC TSN: 1528.3 HOBBS: 1528.3 HOBBS: 1528.3 Airframe Entries	
BEEN INSPECTED IN ACCORDANCE CONDITION. D:	WITH AN ANNUAL INSPECTION AND WAS Work Order: BA-00462-08-2017 Printed by EBis 3 (datcomedia.com)	Bled brakes per Piper PA-32R-301/301T M/M, Chapter 32-40-00. Brakes checked normal. Maintenance Release The aircraft and/or component(s) on N989SR was repaired and inspected in accordance with current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file under Work Order No. BA-00488-12-2017, Dated 3/5/2018. DATE: 3/5/2018 SIGNED: Work Order: BA-00488-12-2017	
		Kerry Allan Hyde, IA: 3/3/403 Printed by EBIS 3 (datcomedia.com) 15/1/18 REMOUR & REPLACE LEM MAIL TUBE 1552. 2 NEW AERO STOP 6.00 x 4 7088. OPS 8 1+ Ce,	w/
2 of 2		G.00), 900 12 AB 28 77455	
2 0 7 2		1 of 1	

Data	Aircraf	t Time	Recorder	Marine	enance	d Domesto	
Date	This Date	Total	Reading	Main	endice	and Remarks	
	Brought Forward →					7/5/. & Remove + RIPLACE RI	
	MODEL: Pa-32r-301t S/N: 3257268 REG. NO: N989SR WORK ORDER: Pho 4897-05-2018 Airframe Entries	entura Aircraft Se 10 Republic Airport mingdale, NY 11735 one: 631-756-5500 ei pump, P/N 10080-D		DATE: 5/30/2018 A/C TSN: HOBBS: 1562.1		1582.1 PEROSTOP 6.00 x 6	
	DATE. 5/30/2018	SIGNED:	Un Ell	Work Order: 4897-05-2018			+
		Dennis McClure	A&P: 3666681	Printed by EBis 3 (datcomedia.com)		1	1
						//	-
						1	+
							-
Total To							-
Carry Forward			1 of 1				

Registration No._

D-4-	Aircraft	Time	Recorder	****
Date	This Date	Total	Reading	Maintena
	Brought Forward			
	MODEL: Pa-32r-3011 S/N: 3257268 8100 REG. NO: N969SR Farm	ntura Aircraft Se D Republic Airport ningdale, NY 11735 ne: 631-756-5500	ervices	DATE: 5/30/2018 A/C TSN: HOBBS: 1562.1
		pump, P/N 10080-D	S/N 205751. Performed run up	and leak checked good.
	DATE: 5/30/2018	SIGNED:	an the	Work Order: 4897-05-2018
		Dennis McClure,	A&P: 3666681	Printed by EBis 3 (datcomedia.com)
ıl To				

Registration	No
--------------	----

and Remarks		Signature	Certificate No.
7/5/.8	Remove + RZPLACE RI	H7 MAID 7	BC W/ NSW
982.1	PEROSTOP 600 X 6	OPS CHER	((00)
, 			

Date This Date Total Reading	Maintenance	



www.maydayavionics.com

5500 44th St. St., Gereid R. Ford International Absort, Grand Rapids, MI 49512 616-957-4920

DATE	8-7-18	S.O.	61077
MAKE	Piper	N#	N989SR
MODEL	PA-32R-301T	S/N	3257268
HOURS	1585.6		

Installed GTS 800 TAS Operating Software Ver. 4.10 in accordance with the Garmin Service Bulletin No.: 1767, Rev A.

All items were ground checked in accordance with their respective manuals for proper operation and to ensure no adverse reactions occurred to other onboard systems or equipment. The above work was performed in accordance with current FAA regulations and in respect to work performed on the aircraft identified above is approved for return to service

FOR FAA CRS YXXR387Y



9464 Co. Rd. 14 Wauseon, Oh 43567

Date: 11/15/2018 Model PA-32R-301T Hobbs 1617.3 Total time 1617.3 N989SR S/N 3257268 TSMOH 1617.3 Engine TIO-540-AH1A Serial L-11082-61A Instructions. Landing gear operational and emergency operational check performed Hydraulic power pack serviced with mildue at 1727.3. ELT ops check good IAW FAR 91.207 (d). Replaced vac regulator filter ARB3-5-1. Replaced instrument Repaired hole in upper cowling with epoxy potted repair. Ops check good. I certify this aircraft has been inspected IAW an annual inspection and is in airworthy condition.			4356/	
N989SR S/N 3257268 TSMOH 1617.3 Engine TIO-540-AH1A Serial L-11082-61A Completed Annual Inspection IAW Piper PA-32R-301T checklist and maintenance manual Serviced and lubricated IAW servicin services. Landing gear operational and emergency operational check performed Hydraulic power pack serviced with mildue at 1727.3. ELT ops check good IAW FAR 91.207 (d). Replaced vac regulator filter ARB3-5-1. Replaced instruments.		419-335	-3993	
Completed Annual Inspection IAW Piper PA-32R-301T checklist and maintenance manual Serviced and lubricated IAW servicing sear operational and emergency operational check performed Hydraulic power pack serviced with milliller RAD9-18-1. Replaced fire extinguisher due to failed weight check page 1.207 (d). Replaced vac regulator filter ARB3-5-1. Replaced instruments		Hobbs 1617.3	Total time 1617.3	
Richard Lee Navos Inch.	Inspection IAW Piper PA-3 ng gear operational and en e hydrostatic test 06/2022 ops check good IAW eplaced fire extinguisher de per cowling with epoxy po ertify this aircraft has been	B2R-301T checklist and nergency operational of expires 96/2032. AD FAR 91.207 (d). Reque to failed weight checkled repair. Ops checkled inspected IAW an angel	Engine TIO-540-AH1A I maintenance manual Servi Check performed Hydraulic p compliance list updated. Co placed vac regulator filter Al	omplied with AD 2015-19-07 nex RB3-5-1. Replaced instrument
Richard Lee Nave		S/N 3257268 Inspection IAW Piper PA-3 ng gear operational and en e hydrostatic test 06/2022 ops check good IAW eplaced fire extinguisher de per cowling with epoxy po ertify this aircraft has been	Model PA-32R-301T Hobbs 1617.3 S/N 3257268 TSMOH 1617.3 Inspection IAW Piper PA-32R-301T checklist and gear operational and emergency operational e hydrostatic test 06/2022, expires 06/2032. AD OPS Check good IAW FAR 91.207 (d). Replaced fire extinguisher due to failed weight check	Model PA-32R-301T Hobbs 1617.3 Total time 1617.3 S/N 3257268 TSMOH 1617.3 Engine TIO-540-AH1A Inspection IAW Piper PA-32R-301T checklist and maintenance manual Service hydrostatic test 06/2022, expires 06/2032. AD compliance list updated. Compliance of the extinguisher due to failed weight check, new extinguisher P/N Assertify this aircraft has been inspected IAW an annual inspection and is in aircraft.