

The Standard

AIRCRAFT LOG

1941-54-2

The Standard Aircraft Log
SA-2

© 1991-2016 Aviation Supplies & Academics, Inc.

ASA-SA-2
ISBN 978-1-56027-117-8

All rights reserved.
Reproduction or use, without express permission,
in any manner, is prohibited.

Published by
Aviation Supplies & Academics, Inc.
7005 132nd Place SE
Newcastle, WA 98059-3153
Website: www.asa2fly.com
Email: asa@asa2fly.com

Printed in the United States of America

02

TRANSPORTATION USD \$12.95

ISBN 978-1-56027-117-8



9 781560 271178

Aircraft Record General Information

Manufacturer Cessna Model 182P
Serial 18264374 Registration Number N1575G
Date of Manufacture 1975

Engine(s) currently installed:

Manufacturer _____ Model _____ Serial _____
Manufacturer _____ Model _____ Serial _____

Propeller(s) currently installed:

Manufacturer _____ Model _____
HUB Model _____ Serial _____ Serial _____
Blade Model _____ Serial _____ Serial _____ Serial _____
Blade Model _____ Serial _____ Serial _____ Serial _____

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	--

MICHIANA AIRCRAFT SERVICE, INC.
4323 West Progress Drive South Bend, IN 46628

Airframe Log Entry

Phone: 574-287-4687 Fax: 574-287-7753

N1575S

Cessna 182P

TTA: 5620.6

Inspections (complied with the following)

- Complied with an Annual inspection.
- Complied with ELT inspection in accordance with FAR 91.207d.
- Complied with AD 87-20-03R2 Seat rail inspection.
- Complied with AD 96-12-22 Oil filter adapter.
- Complied with AD 83-13-01 fuel cap sealing.

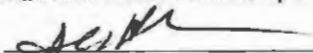
Maintenance

- Re-glued aft bulkhead Velcro.
- Removed and properly installed cabin air heat duct.
- Removed and replaced vacuum reg valve filter P/N B3-5-1.
- Removed and replaced both hrake disc P/N 164-30440.
- Removed and replaced all brake linings P/N 066-30026.
- Removed and replaced engine air intake filter P/N BA8103-1.
- Removed and replaced spinner P/N 0752637K200.

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	--

This Aircraft was repaired in accordance with the manufactures maintenance manual. All systems interrupted have been tested and/or leak checked as necessary. This aircraft is airworthy and is approved for return to service with respect to the work performed.

I certify that this aircraft has been inspected in accordance with an annual inspection and was determined to be airworthy at this time. All AD's checked up to revision dated 4-20-11.

Signature:  John C. Hoffa
Michiana Aircraft Services, Inc. C.R.S. Q6MR956Y
Date: 4-20-11 Work Order #8063

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

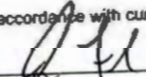
AVIONICS LOG BOOK ENTRY

N 1575S **TIME** 5624.5 Total Time **DATE** 7-21-2011

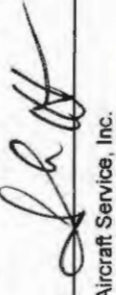
VFR Certification Due.
Tested Transponder; Model: RT 359A, SN: 5874 to comply with FAR Part 43 App. F. Tested Altitude reporting System to comply with FAR Part 43 App. E(c).

*** Page 1 of 1***

Aircraft and/or components above were repaired and inspected in accordance with current federal aviation regulations, and were found airworthy for return to service

Signature:  Work Order: 8887

Premier Aviation, LLC 1441 County Road 6 West • Elkhart, IN 46514 • Tel: 888-496-8100 • Fax: 574-266-8100 • CRS: R6XR149X

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
				<p>Michiana Aircraft Service, Inc Airframe Log Entry 4323 West Progress Drive South Bend, IN 46628 Phone 574-287-4687 Fax 574-287-7753 Cessna 182P N1575S TAT: 5632.5</p> <p>Inspections:</p> <ul style="list-style-type: none"> • Complied with Annual inspection. • Complied with AD83-13-01 fuel cap inspection. • Complied with AD87-20-03R2 seat rail inspection. • Complied with AD96-12-22 oil filter adapter torque inspection. • Complied with AD2011-10-09 seat slippage inspection. • Complied with AD93-05-06 ignition switch inspection. • Complied with ELT inspection in accordance with FAR 91.207(c) Battery expires June 2013. • Removed and replaced right hand fuel cell P/N 3030-24. • Serviced battery. • Installed new induction air filter P/N BA8103-1. • Installed new terminal on right "P" lead at magneto. • Installed new fuel cap seals P/N B100142-1. • Installed new nipple on positive battery cable P/N AA59178-3. <p>This aircraft was repaired in accordance with the manufactures maintenance manual. All systems interrupted have been tested and/ or leak checked as necessary. This aircraft is airworthy and is approved for return to service with respect to the work performed</p> <p>I certify this aircraft has been inspected in accordance with an Annual inspection and was determined airworthy at this time. All AD's current till 4-24-12.</p> <p>Signature: <u></u> John C Hoffa Michiana Aircraft Service, Inc. C.R.S. Q6MR956Y Date: 4-24-12 Work Order #8802</p>

Michiana Aircraft Service, Inc

Airframe Log Entry

4323 West Progress Drive South Bend, IN 46628 Phone 574-287-4687 Fax 574-287-7753

Cessna 182P

N1575S

TAT: 5666.3

Inspections:

- Complied with Annual inspection.
- Complied with AD83-13-01 fuel cap sealing.
- Complied with AD87-20-03R2 seat locking mechanism.
- Complied with AD96-12-22 oil loss/oil adapters.
- Complied with AD2011-10-09 seat slippage.
- Complied with AD93-05-06 ignition switch.
- Complied with ELT inspection in accordance with FAR 91.207(d). **Battery expires January 2017.**

Maintenance:

- Installed new ELT battery P/N BS2190.
- Installed new lower cowling shock mount P/N J7444-24.

This aircraft was repaired in accordance with the manufactures maintenance manual. All systems interrupted have been tested and/ or leak checked as necessary. This aircraft is airworthy and is approved for return to service with respect to the work performed

I certify this aircraft has been inspected in accordance with an Annual inspection and was determined airworthy at this time. All AD's current through 5-8-15.

Signature:

John C Hoffa C.R.S. Q6MR956Y

Date: 5-8-15

Work Order #11088

YEAR	RECORDING	TODAY'S	TOTAL	Description of Inspections	ons of (es.)
------	-----------	---------	-------	----------------------------	--------------

YEAR	RECORDING	TODAY'S	TOTAL	Description of Inspections, Tests, Repairs and Alterations
NO	TACH	FLIGHT	TIME IN	Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
DATE	TIME		SERVICE	

Michiana Aircraft Service, Inc

Airframe Log Entry

4323 West Progress Drive South Bend, IN 46628 Phone 574-287-4687 Fax 574-287-7753

Cessna 182P

N1575S

TAT: 5667.8

Maintenance:

- Installed new battery P/N G35 S/N G02862996.

This aircraft was repaired in accordance with the manufactures maintenance manual. All systems interrupted have been tested and/ or leak checked as necessary. This aircraft is airworthy and is approved for return to service with respect to the work performed

Signature:

John C Hoffa C.R.S. Q6MR956Y

Date: 7-15-15

Work Order #11234

AVIATION PRODUCTS
2021 AVIATION AVENUE
MILLERSVILLE, CA 92274
www.michiana.com

Michiana Aircraft Service, Inc

Airframe Log Entry

4323 West Progress Drive South Bend, IN 46628 Phone 574-287-4687 Fax 574-287-7753

Cessna 182P

N1575S

TAT: 5698.6

Inspections:

- Complied with Annual inspection.
- Complied with AD83-13-01 fuel cap sealing.
- Complied with AD2011-10-09 seat locking mechanism.
- Complied with AD96-12-22 oil loss/oil adapters.
- Complied with AD87-20-03R2 seat locking mechanism.
- Complied with AD93-05-06 ignition switches.
- Complied with ELT inspection in accordance with FAR 91.207(c). **Battery expires February 2019.**

Maintenance:

- Replaced nutplate on right side horizontal stab cover.
- Removed and replaced battery P/N G35.
- Removed and replaced right brake linings P/N 066-30026.
- Replaced tow pin bolt.
- Installed new Nulites on new panel and installed panel into aircraft.

This aircraft was repaired in accordance with the manufactures maintenance manual. All systems interrupted have been tested and/ or leak checked as necessary. This aircraft is airworthy and is approved for return to service with respect to the work performed

I certify this aircraft has been inspected in accordance with an Annual inspection and was determined airworthy at this time. All AD's current through 4-21-17.

Signature: _____

John C Hoffa C.R.S. Q6MR956Y

Date: 4-21-17

Work Order #12161

Michiana Aircraft Service, Inc

Airframe Log Entry

4323 West Progress Drive South Bend, IN 46628 Phone 574-287-4687 Fax 574-287-7753

Cessna 182P

N1575S

TAT: 5702.9

Inspections:

- Complied with Annual inspection.
- Complied with AD83-13-01 fuel cap sealing.
- Complied with AD2011-10-09 seat locking mechanism.
- Complied with AD96-12-22 oil loss/oil adapters.
- Complied with ELT inspection in accordance with FAR 91.207(d). **Battery expires February 2019.**

Maintenance:

- Removed and replaced mixture cable P/N MC600-72.
- Removed and replaced prop control cable P/N MCC2995060102.

Maintenance:

- Adjusted alternator belt tension.
- Removed and replaced induction air filter P/N BA8103-1.
- Serviced battery.
- Removed and replaced broken nutplate of forward rectangle panel right hand wing.
- Repaired broken bolt ear on wheel pants.
- Installed numerous placards on aircraft.

This aircraft was repaired in accordance with the manufactures maintenance manual. All systems interrupted have been tested and/ or leak checked as necessary. This aircraft is airworthy and is approved for return to service with respect to the work performed

I certify this aircraft has been inspected in accordance with an Annual inspection and was determined airworthy at this time. All AD's current through 5-14-18.

Signature: _____

Michael Hannon C.R.S. Q6MR956Y

Date: 5-14-18

Work Order #13035

Year: _____
Description of Inspections, Tests, Repairs and Alterations

YEAR /0 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
--------------------	---------------------------	-------------------	-----------------------------	---

Michiana Aircraft Service, Inc **Airframe Log Entry**

4323 West Progress Drive South Bend, IN 46628 Phone 574-287-4687 Fax 574-287-7753

Cessna 182 N1575S

Tach: 5698.6

Maintenance

- Removed Garmin GTX 345 P/N 011-03302-40 S/N 3EG401317 and installed P/N 011-03302-40 S/N 3EG402031.

The above systems were ramp checked in accordance with manufacturers' installation manuals listed above and were found to operate within manufacturers' performance specifications. No interference was found between the installed systems and the existing systems in the aircraft.

All work performed in accordance with AC 20-138B; AC 43.13-1B, Chapter 11, and 43.13-2A, Chapter 2. The weight/balance and equipment lists have been revised.

Signature:  Kevin Haldeman C.R.S. Q6MR956Y

Date: 7-13-18 Work Order #13251

Michiana Aircraft Service, Inc **Airframe Log Entry**

4323 West Progress Drive South Bend, IN 46628 Phone 574-287-4687 Fax 574-287-7753

Cessna 182P N1575S

TAT: 5713.0

Inspections:

- Complied with Annual inspection.
- Complied with AD83-13-01 fuel cap sealing.
- Complied with AD2011-10-09 seat locking mechanism.
- Complied with ELT inspection in accordance with FAR 91.207(d, Battery expires February 2021).

Maintenance:

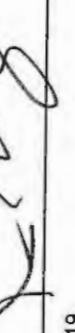
- Removed and replaced ELT battery P/N BS2190.
- Replaced left fuel bladder P/N 1200065-23 and drain valve P/N 84C.
- Installed new alternator belt P/N S2416-1-31.0
- Installed new fuel standpipe P/N 0756011-1.
- Repaired instrument light wire.

Maintenance:

- Stop drilled crack in landing gear fairing.
- Replaced bottom right cowl mount P/N J7444-24.
- Removed and replaced both main tires P/N 606C81B1.

This aircraft was repaired in accordance with the manufactures maintenance manual. All systems interrupted have been tested and/or leak checked as necessary. This aircraft is airworthy and is approved for return to service with respect to the work performed

I certify this aircraft has been inspected in accordance with an Annual inspection and was determined airworthy at this time. All AD's current through 5-10-19.

Signature:  Steve Purvis C.R.S. Q6MR956Y
Date: 5-10-19 Work Order #13963

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
--------------------	---------------------------	-------------------	-----------------------------	---

Michiana Aircraft Service, Inc Airframe Log Entry

4323 West Progress Drive South Bend, IN 46628 Phone 574-287-4687 Fax 574-287-7753

Cessna 182P

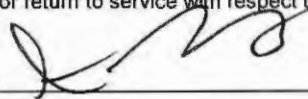
N1575S

TAT: 5717.5

Maintenance:

- Replaced carb heat cable P/N MC1230-10.
- Installed remote antenna P/N 010-10702-00 on Garmin 550.

This aircraft was repaired in accordance with the manufactures maintenance manual. All systems interrupted have been tested and/ or leak checked as necessary. This aircraft is airworthy and is approved for return to service with respect to the work performed.

Signature: 

Steve Purvis C.R.S. Q6MR956Y

Date: 7-30-19

Work Order #14190

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
--------------------	---------------------------	-------------------	-----------------------------	---

Michiana Aircraft Service, Inc CRS#Q6MR956Y

4323 West Progress Drive South Bend, IN 46628-574-287-4687

N1575S Tach: 5718.1

ALTITUDE METER, STATIC AND TRANSPONDER CERTIFICATE

	-1	0	.5	1	1.5	2	3	4	5	6	8	10	12	14	15	16
20	20	20	20	20	25	30	30	35	40	40	60	80	90	100	90	110
30	30	30	30	35	40	45	45	50	50	50	80	80	90	100	100	110
40	40	40	40	45	50	55	55	60	60	60	90	90	100	100	100	110
50	50	50	50	55	60	65	65	70	70	70	100	100	110	110	110	110
60	60	60	60	65	70	75	75	80	80	80	110	110	120	120	120	130
70	70	70	70	75	80	85	85	90	90	90	120	120	130	130	130	140
80	80	80	80	85	90	95	95	100	100	100	130	130	140	140	140	150
90	90	90	90	95	100	105	105	110	110	110	140	140	150	150	150	160
100	100	100	100	105	110	115	115	120	120	120	150	150	160	160	160	170
110	110	110	110	115	120	125	125	130	130	130	160	160	170	170	170	180
120	120	120	120	125	130	135	135	140	140	140	170	170	180	180	180	190
130	130	130	130	135	140	145	145	150	150	150	180	180	190	190	190	200
140	140	140	140	145	150	155	155	160	160	160	190	190	200	200	200	210
150	150	150	150	155	160	165	165	170	170	170	200	200	210	210	210	220
160	160	160	160	165	170	175	175	180	180	180	210	210	220	220	220	230
170	170	170	170	175	180	185	185	190	190	190	220	220	230	230	230	240
180	180	180	180	185	190	195	195	200	200	200	230	230	240	240	240	250
190	190	190	190	195	200	205	205	210	210	210	240	240	250	250	250	260
200	200	200	200	205	210	215	215	220	220	220	250	250	260	260	260	270
210	210	210	210	215	220	225	225	230	230	230	260	260	270	270	270	280
220	220	220	220	225	230	235	235	240	240	240	270	270	280	280	280	290
230	230	230	230	235	240	245	245	250	250	250	280	280	290	290	290	300
240	240	240	240	245	250	255	255	260	260	260	290	290	300	300	300	310
250	250	250	250	255	260	265	265	270	270	270	300	300	310	310	310	320
260	260	260	260	265	270	275	275	280	280	280	310	310	320	320	320	330
270	270	270	270	275	280	285	285	290	290	290	320	320	330	330	330	340
280	280	280	280	285	290	295	295	300	300	300	330	330	340	340	340	350
290	290	290	290	295	300	305	305	310	310	310	340	340	350	350	350	360
300	300	300	300	305	310	315	315	320	320	320	350	350	360	360	360	370
310	310	310	310	315	320	325	325	330	330	330	360	360	370	370	370	380
320	320	320	320	325	330	335	335	340	340	340	370	370	380	380	380	390
330	330	330	330	335	340	345	345	350	350	350	380	380	390	390	390	400
340	340	340	340	345	350	355	355	360	360	360	390	390	400	400	400	410
350	350	350	350	355	360	365	365	370	370	370	400	400	410	410	410	420
360	360	360	360	365	370	375	375	380	380	380	410	410	420	420	420	430
370	370	370	370	375	380	385	385	390	390	390	420	420	430	430	430	440
380	380	380	380	385	390	395	395	400	400	400	430	430	440	440	440	450
390	390	390	390	395	400	405	405	410	410	410	440	440	450	450	450	460
400	400	400	400	405	410	415	415	420	420	420	450	450	460	460	460	470
410	410	410	410	415	420	425	425	430	430	430	460	460	470	470	470	480
420	420	420	420	425	430	435	435	440	440	440	470	470	480	480	480	490
430	430	430	430	435	440	445	445	450	450	450	480	480	490	490	490	500
440	440	440	440	445	450	455	455	460	460	460	490	490	500	500	500	510
450	450	450	450	455	460	465	465	470	470	470	500	500	510	510	510	520
460	460	460	460	465	470	475	475	480	480	480	510	510	520	520	520	530
470	470	470	470	475	480	485	485	490	490	490	520	520	530	530	530	540
480	480	480	480	485	490	495	495	500	500	500	530	530	540	540	540	550
490	490	490	490	495	500	505	505	510	510	510	540	540	550	550	550	560
500	500	500	500	505	510	515	515	520	520	520	550	550	560	560	560	570
510	510	510	510	515	520	525	525	530	530	530	560	560	570	570	570	580
520	520	520	520	525	530	535	535	540	540	540	570	570	580	580	580	590
530	530	530	530	535	540	545	545	550	550	550	580	580	590	590	590	600
540	540	540	540	545	550	555	555	560	560	560	590	590	600	600	600	610
550	550	550	550	555	560	565	565	570	570	570	600	600	610	610	610	620
560	560	560	560	565	570	575	575	580	580	580	610	610	620	620	620	630
570	570	570	570	575	580	585	585	590	590	590	620	620	630	630	630	640
580	580	580	580	585	590	595	595	600	600	600	630	630	640	640	640	650
590	590	590	590	595	600	605	605	610	610	610	640	640	650	650	650	660
600	600	600	600	605	610	615	615	620	620	620	650	650	660	660	660	670
610	610	610	610	615	620	625	625	630	630	630	660	660	670	670	670	680
620	620	620	620	625	630	635	635	640	640	640	670	670	680	680	680	690
630	630	630	630	635	640	645	645	650	650	650	680	680	690	690	690	700
640	640	640	640	645	650	655	655	660	660	660	690	690	700	700	700	710
650	650	650	650	655	660	665	665	670	670	670	700	700	710	710	710	720
660	660	660	660	665	670	675	675	680	680	680	710	710	720	720	720	730
670	670	670	670	675	680	685	685	690	690	690	720	720	730	730	730	740
680	680	680	680	685	690	695	695	700	700	700	730	730	740	740	740	750
690	690	690	690	695	700	705	705	710	710	710	740	740	750	750	750	760
700	700	700	700	705	710	715	715	720	720	720	750	750	760	760	760	770
710	710	710														

